

## **BLANK PAGE**



IS: 4156 - 1967 (Reaffirmed 1989)

# Indian Standard METHODS FOR SAMPLING OF BARYTES

(First Reprint MAY 1990)

UDC 553.689:543.05

@ Copyright 1967

BUREAU OF INDIAN STANDARDS
MANAK BHAVAN, 9 BAHADUR SHAH ZAFAR MARG
NEW DELHI 110002

## Indian Standard

### METHODS FOR SAMPLING OF BARYTES

#### Methods of Sampling Sectional Committee, SMDC 4

Chairman

Representing

DR A. V. SURHATME

The Tata Iron & Steel Co Ltd, Jamshedpur

Members

SHRI V. D. AGARWAL

Light Metals and Their Alloy Products Sectional Committee, SMDC 10, ISI

SHRI O. P. MATHUR ( Alternate)

Shri J. C. Banerjee DR U. N. BHRANY

Refractories Sectional Committee, SMDC 18, ISI

Indian Iron & Steel Co Ltd, Burnpur

Shbi A. C. Mukherjee ( Alternate ) DR M. K. BOSE

Precious Metals Sectional Committee, SMDC 13.

CHEMIST & METALLURGIST, Railway Board (Ministry of Railways)

SOUTH EASTERN RAILWAY, KHABAGPUR

CHEMIST & METALLUBGIST,

RDSO, CHITTABANJAH ( Alternate )

SHRI R. N. DATTA Directorate General of Ordnance Factories

( Ministry of Defence ), Calcutta

SHBI D. K. CHAKBAVARTY ( Alternate ) ( Muradnagar )

SHRI D. SEN ( Alternate ) (Ishapore)

SHRI S. K. DUTTA

Directorate General of Inspection (Ministry of

Defence )

SHRI J. BHATTACHARJER ( Alternate )

SHRI S. B. FIRKE

Copper and Copper Alloys Sectional Committee, SMDC 11, ISI

SHRI CHINTAMANI SHARMA ( Alternate )

SERI A. GUHA

Cast Iron & Malleable Cast Iron Sectional Com-

mittee, SMDC 9, ISI SHRI S. S. HONAVAR Italab Private Ltd. Bombay

SHBI J. P. PATEL ( Alternate )

Dr N. Jayabaman

Essen & Co, Bangalore

SHRI K. N. GURUBAJACHAB ( Alternate )

SHRI R. M. KRISHNAN Foundry Sectional Committee, SMDC 17, ISI

SHRI D. B. LAHIRI Indian Statistical Institute, Calcutta

DR A. MATTHAI ( Alternate )

(Continued on page 2)

BUREAU OF INDIAN **STANDARDS** MANAK BHAVAN, 9 BAHADUR SHAH ZAFAR MARG **NEW DELHI 110002** 

(Continued from page 1)

Members

Representing

SHRI N. MAJUMDAR

Indian Non-ferrous Metals Manufacturers' Association, Calcutta

SHRI M. M. MOUDGILL ( Alternate )

DR N. T. MATHEW Statistical Organization (Ministry of Defence)

SHRI S. P. AGARWALA (Alternate) SHRI N. C. MITRA

Government of India Mint (Ministry of Finance)

DR M. K. BOSE ( Alternate )

SHRI S. N. MUKERJI

National Test House, Calcutta

SHRI A. K. BHATTACHARJEE ( Alternate )

DR G. MUKHERJEE

Ferro Alloys Sectional Committee, SMDC 8, ISI; and Steel Tubes, Pipes and Fittings Sectional Committee, SMDC 22, ISI Ores and Raw Materials Sectional Committee.

SHRI D. S. MURTY

SMDC 16. ISI

SHRIE. K. N. NAMBIAR

Directorate General of Supplies & Disposals (Ministry of Works, Housing & Supply); Steel Castings Sectional Committee, SMDC 20, ISI; and Pig Iron Sectional Committee, SMDC 24, ISI

SHRI G. V. HALWE (Alternate) SHRI A. PADMANABHAN SHRI M. K. RAO

Directorate General of Supplies & Disposals

SHBI D. K. RAY

(Ministry of Works, Housing & Supply)
Steel Forgings Sectional Committee, SMDC 21, ISI
Lead, Zinc, Tin, Antimony and Their Alloys
Sectional Committee, SMDC 12, ISI

REPRESENTATIVE

Wrought Steel Products Sectional Committee, SMDC 5, ISI Analysis

SHRI G. V. D. UPADHYAYA

Methods of Chemical A Committee, SMDC 2, ISI Indian Bureau of Mines (Ministry of Steel, Mines and Metals), Nagpur

SHRI V. V. S. R. H. RAO ( Alternate )

SHRI S. VISWANATHAN

Methods of Physical Tests Sectional Committee, SMDC 3, IŠI

DR B. N. SINGH. Deputy Director (Stati) Director General, ISI (Ex-officio Member)

Secretary

SHRI Y. K. BHAT

Deputy Director (Stati), ISI

Subcommittee on Sampling of Ores, SMDC 4:3

Convener

SHRI B. B. GHOSHAL

In personal capacity (Ananda Bhavan, Upper Chelidanga, Asansol, District Burdwan)

Members

DE RAMAN C. AMIN

Therapeutics Chemical Research Corporation. Bombay

SHRI M. V. VAIDYA ( Alternate ) SERI S. K. BHATTACHARJEE Hindusten Steel Ltd. Ranchi

(Continued on page 16)

## Indian Standard

# METHODS FOR SAMPLING OF BARYTES

#### 0. FOREWORD

- 0.1 This Indian Standard was adopted by the Indian Standards Institution on 26 June 1967, after the draft finalized by the Methods of Sampling Sectional Committee had been approved by the Structural and Metals Division Council.
- 0.2 Barytes is an important mineral which is used in large quantities in oil-well drilling and in paints and rubber industries as a pigment. It is a starting raw material for the manufacture of barium chemicals which are now being produced in India. With the opening of more oil-wells in the country, the consumption of barytes is likely to increase steadily. It is also being exported to overseas countries. This standard is intended to fulfil the need for proper methods of sampling which become very important for sound and satisfactory evaluation of quality.
- 0.3 For obtaining reliable conclusions it has been recommended that as far as possible, barytes be sampled when in motion, that is, during loading or unloading. When sampling of stationary ores, for example, from stock piles becomes inevitable, the 'sectional' or the 'trench' sampling method may be used for stock piles up to a maximum height of 1.5 m but the representativeness of the samples drawn in this manner and hence the reliability of the conclusions are not assured.
- 0.4 Barytes is generally offered for sale in the following three forms:
  - a) Bulk as run-of-mine up to 200 mm size;
  - b) Bulk as small ore up to 50 mm size (known as pebble ore in the trade); and
  - c) Crushed and ground form up to 0.05 mm size, generally packed in bags.
- **0.4.1** The methods for sampling of crushed and ground barytes corresponding to form (c) have been laid down in the respective material specifications required for different industries. This standard, therefore, deals only with sampling of barytes in bulk in the forms (a) and (b) mentioned in **0.4**.

- 0.5 Taking into consideration the views of producers, testing authorities and consumers, the Sectional Committee felt that it should be related to the sampling procedures generally followed in this country for barytes as also for other ores in bulk.
- 0.6 This standard is one of a series of Indian Standards on sampling of ores and aggregates; other standards on methods of sampling in this series are:

IS: 1405-1965 Iron ore (first revision)

1S: 1449-1961 Manganese ore

IS: 1811-1961 Foundry sands

IS: 1999-1962 Bauxite

IS: 2109-1962 Dolomite, limestone and other allied materials

IS: 2245-1962 Quartzite

IS: 2246-1963 Fluorspar (fluorite)
IS: 4166-1967 Ilmenite and rutile

0.7 In reporting the results of a test or analysis, if the final value, observed or calculated, is to be rounded off, it shall be done in accordance with IS: 2-1960\*.

#### 1. SCOPE

- 1.1 This standard lays down the procedure to be followed in collecting and preparing samples from a lot in order to determine size distribution, moisture content and chemical composition of barytes in bulk.
- 1.2 It does not cover barytes in crushed and ground form for which sampling procedures have been laid down in the respective material specifications.
- 1.3 Sampling of barytes in railway wagons or trucks, ship's holds and stock piles have been considered separately.
- 1.4 This standard also includes a method for reporting the quality of bulk of the ore sampled.

#### 2. TERMINOLOGY

- 2.0 For the purpose of this standard, the following definitions shall apply.
- 2.1 Lot The quantity of barytes offered by the supplier for inspection

<sup>\*</sup>Rules for rounding off numerical values ( revised ).

at one time. A lot may consist of the whole or a part of the quantity ordered for.

- 2.2 Sub-Lot The quantity of barytes representing each part or portion into which a lot is divided for the purpose of sampling.
- 2.3 Increment The quantity of barytes obtained by the sampling device at one time from a lot or sub-lot.
- 2.4 Gross Sample The quantity of barytes obtained by mixing together all the increments collected from a sub-lot.
- 2.5 Composite Sample The sample obtained by mixing the weighted quantities of gross samples or laboratory samples of different sub-lots to constitute the sample representing an entire lot.
- 2.6 Size Sample A sample taken for the determination of the size distribution of the lot or sub-lot.
- 2.7 Laboratory Sample The quantity of barytes obtained by reducing the gross sample or composite sample following a specified procedure and intended for laboratory testing for chemical analysis only.
- 2.8 Moisture Sample A sample to be used exclusively for the purpose of determining moisture content.

#### 3. GENERAL RULES OF SAMPLING

- 3.1 The increments shall be collected only with the sampling scoop and should not be picked up by hand.
- 3.2 The containers and equipment used for collecting, preserving and preparing the samples should be sufficiently clean as to avoid contamination of the samples. If gunny bags are used, these should be clean and of close texture to avoid loss of fines in the samples. Particular care must be taken to avoid contamination with iron since there is often a very rigid limit on this impurity in barytes.
- 3.3 The samples should be always kept in a place sufficiently protected to avoid changes in its quality, particularly in respect of moisture.
- 3.4 A gross sample may be used for the combined purpose of determining size, moisture and chemical composition. In such a case, the size determination should be carried out first before preparing the sample for moisture and chemical composition.
- 3.5 When moisture content is required for the lot and the same gross sample is to be used for preparation of moisture sample and laboratory

sample, the gross sample should be processed as quickly as possible after collection up to the stage where moisture sample is collected, in order to avoid changes in moisture by long storage.

3.6 Moisture samples should always be collected in airtight containers to avoid changes in moisture content and these should be sent to the laboratory for testing without delay.

#### 4. INCREMENTS

4.1 Increments should be taken with the sampling scoop the design of which is shown in Fig. 1.

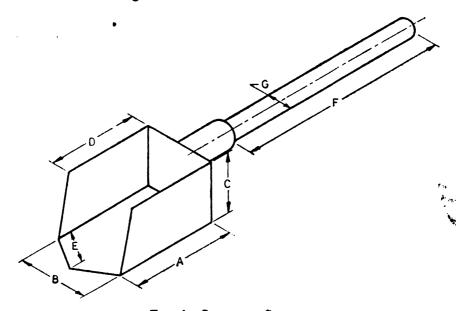


Fig. 1 Sampling Scoop

- 4.2 The size of sampling scoop to be selected depends on the maximum lump size of the ore as shown in Table 1.
- 4.3 The increments taken should be of approximately uniform weights.
- 4.4 Where big lumps exceeding the weight of increment to be taken are encountered at the point selected for sampling, the entire lump shall be collected if the sample is to be used for size determination also. Otherwise, the lump may be broken and the required weight of increment collected from pieces.

## AMENDMENT NO. 1 MARCH 1983

TO

# IS: 4156-1967 METHODS FOR SAMPLING OF BARYTES

[Since the publication of IS: 4156 in 1967 the export of barytes from India has increased substantially both in lump and powder form. This has necessitated the revision of Table 2 of the standard which deals with the number of sublots to be formed. Further the dimensions of sampling scoop for taking 8 kg increment needed slight changes to accommodate large particle sizes.

Taking the above aspects into consideration, the Methods of Sampling Sectional Committee, responsible for the preparation of this standard, has decided to issue the following amendment.]

#### Alterations

(Page 7, Table 1, first entries) — Substitute the following entries under respective columns for the existing entries:

(1)	(2)	(3)	(4)	(5)	(6)	(7)	(8)	(9)
8	200	200	200	100	175	115	440	40

( Page 7, Table 2 ) — Substitute the following for the existing table:

#### TABLE 2 NUMBER OF SUB-LOTS INTO WHICH A LOT IS TO BE DIVIDED

(Clauses 5.1, 7.1, 8.1, 9.1.1, 9.2.1.1 and 9.2.2.1)

WEIGHT OF THE LOT (TONNES)	NUMBER OF SUB-LOT	
Up to 2000	2	
2 001 ,, 5 000	3	
5 001 ,, 10 000	4	
10 001 ,, 25 000	5	
25 001 and above	6	

(SMDC 4)

#### TABLE 1 DIMENSIONS OF SAMPLING SCOOP

(Clauses 4.2, 7.3, 8.2, 9.1.3 and 9.2.2.3, and Fig. 1)

CAPACITY OF SCOOP	MAXIMUM LUMP Size	DIMENSIONS						
SCOOP		A	B	C	D	E	F	G
(1)	(2)	(3)	(4)	(5)	(6)	(7)	(8)	(9)
kg	mm	mm	mm	mm	mm	mm	mm	mm
8 2	<b>200</b> 50	220 175	150 100	125 100	190 150	85 65	440 330	<b>40</b> <b>3</b> 0

Note — Dimensions A to D should be exact and E to G are optional, given only for guidance.

#### 5. SUB-LOTS

5.1 For the purpose of sampling, a lot may be divided into a number of sub-lots of approximately equal weights as specified in Table 2.

NOTE 1 — When it is not practicable to have sub-lots of approximately equal weights, sub-lots of varying weights may also be permitted.

NOTE 2 — The object of dividing a lot into a number of sub-lots is only to facilitate the drawing of a representative gross sample rather than to indicate its physical division.

## TABLE 2 NUMBER OF SUB-LOTS INTO WHICH A LOT IS TO BE DIVIDED

(Clauses 5.1, 7.1, 8.1, 9.1.1, 9.2.1.1 and 9.2.2.1)

Weight of the Lot Tonnes	Number of Sub-Lots		
Up to 1500	2		
1501 , 3000	3		
3001 , 6000	4		
6 001 ,, 10 000	5		
10 001 and above	6		

#### 6. NUMBER OF INCREMENTS

6.1 The number of increments to be taken from a sub-lot shall be as given below:

	Category of Ore		
Weight of gross sample, kg, Min Weight of increment, kg, Approx Number of increments, Min	Run of Mine 300 8 38	Small 100 2 50	

#### 7. SAMPLING FROM WAGONS OR TRUCKS

- 7.1 For the purpose of sampling, all the wagons or trucks in a lot shall be divided into a suitable number of sub-lots of approximately equal weight as specified in Table 2.
- 7.2 The samples shall be drawn when the ore is being loaded into or unloaded from wagons or trucks.
- 7.3 The size of increment and sampling scoop shall be decided as specified in Table 1.
- 7.4 The minimum number of increments for each sub-lot shall be 38 for run of mine and 50 for small ore.
- 7.5 A minimum of 25 percent of the wagons or trucks shall be selected at random from the sub-lot. From each of the wagons or trucks so chosen, an approximately equal number of increments shall be collected so as to obtain the specified minimum number of increments from the sub-lot. The increments shall be drawn with the help of a suitable sampling scoop (see Fig. 1) at regular intervals at the time of loading or unloading of the wagons or trucks.
- 7.6 The points in a wagon or truck at which the increments are to be drawn shall be suitably varied so as to cover different locations and depths.
- 7.7 Combine the increments in a sub-lot to form the gross sample.
- 7.8 Sampling from loaded wagons or trucks is not generally recommended. If, however, this becomes unavoidable, then the gross sample shall be made up of unit samples as given below:

Category of Ore	Minimum Number of Unit Samples		
Run-of-mine	7		
Small	5		

7.8.1 For collecting these unit samples, an equal number of points shall be located at random on the entire ore surface of all the wagons or trucks in a sub-lot. At every selected point a unit sample shall be collected by sectional sampling method (see 9.2.1).

#### 8. SAMPLING FROM SHIPS

8.1 For the purpose of sampling, the quantity of ore loaded into or unloaded from a ship shall be divided into a suitable number of sub-lots of approximately equal weight as specified in Table 2.

NOTE — In case it becomes desirable to sample each hatch or hold of the ship separately, the quantity of ore in each of the hatches which are treated as sub-lots should be ascertained beforehand.

- 8.2 The size of increment and sampling scoop shall be decided as specified in Table 1.
- 8.3 The minimum number of increments for each sub-lot shall be 38 for run of mine and 50 for small ore.
- 8.4 The increments should be uniformly spread over the total quantity in each sub-lot. Thus the interval of sampling should be approximately equal and this will be equal to the total quantity in each sub-lot divided by the number of increments to be collected.
- 8.5 The increments may be collected either from the loading device which may be baskets, skips, grab, bucket, belt, etc, or if possible, it may be collected actually from the hatch of the ship where the ore is discharged by the loading device.
- 8.6 Combine the increments in a sub-lot to form the gross sample.

#### 9. SAMPLING FROM STACKS OR STOCK PILES

9.0 Samples shall be drawn when the stack or stock pile is cleared for loading into wagons or trucks. However, since sale of barytes is often effected on the basis of stack sampling, procedure has also been laid down for sampling from stationary stacks.

#### 9.1 Sampling During Clearance of Stack or Stock Pile

- 9.1.1 The total quantity to be sampled should be divided into suitable number of sub-lots as specified in Table 2.
- 9.1.2 If the stock pile is in a regular rectangular form with levelled top surface, the sub-lots can be clearly marked out in the stock pile. If this is not possible due to uneven shape of stock pile, the formation of sub-lots may be decided from the total quantity of the material loaded.
- 9.1.3 The size of increment and sampling scoop to be used is decided from the maximum lump size of ore as specified in Table 1.
- 9.1.4 The minimum number of increments to be drawn shall be 38 for run of mine and 50 for small ove.
- 9.1.5 The specified number of increments are spread over the entire sub-lot uniformly with a random start so that increments are taken at fixed quantity intervals.
- 9.1.6 The increments taken for each sub-lot are mixed together to form the gross sample.

#### 9.2 Sampling from Stationary Stacks or Stock Piles

- 9.2.0 In sampling stationary stacks, the following points should be taken into consideration:
  - a) Since it is not possible to draw increments uniformly spread over the total quantity in a sub-lot, samples should be drawn from maximum possible number of points.
  - b) Two methods, namely, sectional sampling and trench sampling have been specified. These may be applicable only in cases of stock piles of height less than 1.5 m.

#### 9.2.1 Sectional Sampling

- 9.2.1.1 The lot is divided into the requisite number of sub-lots as specified in Table 2. Each sub-lot should be properly marked out in the stock pile.
- 9.2.1.2 The gross sample is made up of the number of unit samples specified in 7.8. For collecting these, the required number of points should be marked out at random over the surface of the ore in the sub-lot.
- 9.2.1.3 At every selected point, a unit sample shall be collected by taking the entire cross-section of the ore from top to bottom over the area of a circle of 200 mm diameter. For doing this, the ore from the surface up to a depth of approximately 250 mm shall be collected first. The bottom of the hole so formed shall be then covered with a plate and the ore lying on the sides of the hole shall be removed up to the level of the plate. The plate is then removed and the hole dug further to collect the sample. The process is repeated till the bottom is reached.

#### 9.2.2 Trench Sampling

- 9.2.2.1 The lot is divided into requisite number of sub-lots as specified in Table 2. Each sub-lot shall be properly marked out.
- 9.2.2.2 Each sub-lot (sub-stack) shall be trenched in the following manner:
  - a) The direction and pattern of trenches should be at random without following definite pattern. The pattern should be changed from sub-lot to sub-lot.
  - b) The trench should extend right up to the bottom of the stack until the ground level is exposed.
  - c) In addition to the trenches, the sides of the stack should be opened to expose the ore inside the stack at places where the trench does not expose the ore inside.

- 9.2.2.3 The size of increment and sampling scoop to be used thall be decided from the maximum lump size as given in Table 1.
- 9.2.2.4 The minimum number of increments to be drawn shall be 38 for run of mine and 50 for small ore. These increments shall be uniformly spread over the entire sub-lot. They shall also be taken uniformly from the entire cross-section of the exposed sides of trenches from top to bottom.
  - 9.2.2.5 Combine all the increments to form the gross sample,

#### 10. DETERMINATION OF ORE SIZES

- 10.1 Determination of ore sizes shall be carried out before the gross sample is taken up for sample preparation for moisture and chemical analysis, in case a common sample is drawn for size and quality.
- 10.2 The sizes of screens to be used shall be decided as required by the parties concerned. The normal sizes required are as follows:
  - a) Over 200 mm
  - b) Over 50 mm and up to 200 mm, and
  - c) 50 mm and below.
- 10.3 The total gross sample should first be weighed to ascertain its total weight.
- 10.4 The gross sample shall be screened progressively from largest size screen to the smallest one.
- 10.5 The different size groups obtained shall be kept separate and weighed separately.

#### 10.6 Calculations

10.6.1 The percentage of each size in a sub-lot (on weight basis) is calculated as follows:

Size percentage = 
$$\frac{\text{weght of each size group}}{\text{total weight of gross sample}} \times 100$$

10.6.2 When the percentage of each size group in the entire lot is required, this shall be calculated as follows:

Percentage in each size group = 
$$\frac{a_1 + a_2 + \dots}{w_1 + w_2 + \dots} \times 100$$

where

 $a_1, a_2, \dots$  are the corresponding weights of the respective size group in each of the sub-lots; and

 $w_1, w_2, \dots$  are the weights of different gross samples of sub-lots.

#### 11. MEDUCTION OF GROSS SAMPLE

- 11.1 Each gross sample shall be reduced separately. If, however, separate analysis of each sub-lot is not required, the gross samples of each sub-lot shall be crushed up to 5 mm size as shown in Fig. 2. After this the gross samples shall be mixed in proportion of the quantities represented by their respective sub-lots to form a composite sample which shall then be reduced as shown in Fig. 2.
- 11.2 Crushing and grinding shall be done with either mechanical equipment like jaw crusher, cone crusher, roll crusher, disc grinder, etc, or manually with steel plate and hammer or mortar and pestle.
- 11.3 The equipment required for crushing, reduction, screening, storing and handling, etc, of the samples shall be cleaned sufficiently to avoid any contamination of the sample. Particular care should be taken to remove the remnants of the previous sample processed in the equipment.
- 11.4 The gross sample after being subjected to the size test, if necessary, shall be crushed to pass completely through 10 mm screen. It shall then be reduced by coning and quartering, riffle divider, sample spliter, rotary divider or increment reduction method to a quantity not less than 50 kg.

#### 11.5 Reduction Methods

- 11.5.1 Coning and Quartering The crushed ore shall be well mixed and then scooped into a cone-shaped pile. Care shall be taken to drop each scoopful exactly over the apex of the cone to avoid uneven distribution of lumps and fines. The cone thus formed shall be flattened by pressing the top of the cone with a smooth flat surface. The cone is then divided into 4 quarters by 2 lines intersecting at right angles at the centre of the cone. Any 2 diagonally opposite quarters are rejected. The other two quarters form the reduced sample which may be further reduced by the same procedure, if necessary, or taken for further crushing. In rejecting the two opposite quarters, care shall be taken to brush away and reject the fine powder remaining at the bottom on the plate, canvas, etc, used for reduction.
- 11.5.2 Riffle Divider The crushed material shall be well mixed and then poured uniformly into the riffle divider. The sample collected on one side of the divider shall be taken and that on the other side rejected. In order to avoid any errors due to fabrication of the divider, the side which is taken for rejecting the sample, shall be changed alternately. The dividers of different sizes according to the size of crushed ore shall be used.

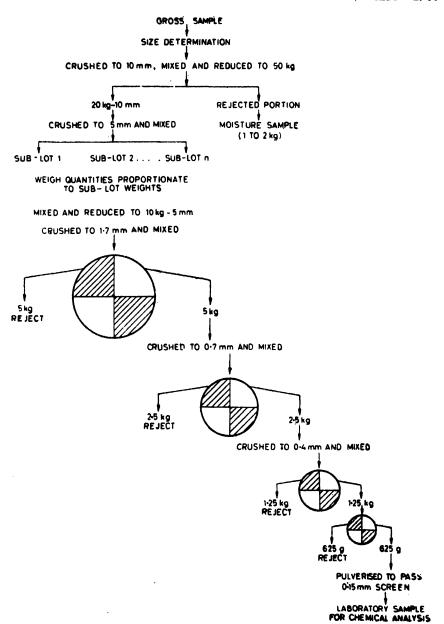


Fig. 2 Reduction of a Gross Sample

0.4

- 11.5.2.1 While the design and dimensions of the riffle dividers is not standardized, the following important requirements should be satisfied by the dividers used:
  - a) The total number of riffles should be even, normally 16, and
  - b) The width of riffles should be uniform in all the riffles and this should be atleast twice the size of the maximum particle size of the crushed material.
- 11.5.3 Other Mechanical Dividers Mechanically operated dividers like rotary divider may be used provided their efficiency has been tested.
- 11.5.4 Increment Reduction The crushed ore shall be mixed and spread on a smooth non-absorbant surface to form a uniform flat rectangle with the thickness specified in Table 3. The rectangle shall be divided into 20 equal parts, 5 lengthwise and 4 breadthwise. From each of the 20 parts so formed, equal quantities of ore shall be taken with a scoop, the capacity of which shall be as shown in Table 3. The 20 increments taken are combined to form the reduced sample.

Size of Ore	THICKNESS OF LAYER	QUANTITY OF INCREMENT TAKEN FROM EACH PART		
mm	mm	g		
10	30 to 40	500		
5	25 ,, 35	250		
1.7	15 , 25	, 100		
0.7	10 15	KO		

10

25

TABLE 3 INCREMENT REDUCTION

- 11.6 Moisture, Sample From the rejected portion of the gross sample at 10 mm stage, a moisture sample of 1 to 2 kg shall be taken after proper mixing of the rejected sample. This sample shall be transferred immediately to a container like bottle or polythene jar with an air-tight moisture-proof cap. Separate moisture sample for each sub-lot shall be collected. These shall be sent immediately to the laboratory and the moisture test carried out without delay in order to avoid changes in moisture content.
- 11.7 Laboratory Sample The laboratory sample after being reduced and crushed to pass through 150-micron IS Sieve, as given in Fig. 2, shall be mixed and divided into 3 or more (if necessary) equal parts. These shall be preserved in clean and dry, well stoppered bottles and

labelled with full particulars, such as source, supplier's name, purchaser's name, date and place of sampling, total quantity, name of steamer, if any, and any other relevant details.

#### 12. NUMBER OF TESTS

- 12.1 Moisture Samples All the moisture samples representing a lot shall be tested individually for moisture content. From the quantities representated by the individual sub-lots, the composite moisture for the entire lot shall be calculated as given in formula in 13.3.2 and reported.
- 12.2 Laboratory Samples When the variation in quality of individual sub-lots is required or when required by the parties concerned, each gross sample shall be individually tested for important characteristics, namely, barium sulphate, silica and iron. When, however, only the average quality of the lot is required, the composite sample prepared as shown in Fig. 2, shall be tested for all the chemical characteristics required by the parties concerned.

#### 13. REPORTING

- 13.1 Size Test The percentages of different size groups for the entire lot shall be reported (see 10.6.2) unless otherwise required by the parties concerned in which case the results for each sub-lot may be reported,
- 13.2 Moisture Test The average moisture content for the entire lot shall be reported unless otherwise required by the parties concerned, in which case the results of each sub-lot shall be reported.

#### 13.3 Chemical Analysis

- 13.3.1 When only the composite sample has been tested, only one test result will be available for each characteristic and that result shall be reported as the value of the characteristic for the lot.
- 13.3.2 When two or more laboratory samples have been tested individually for a lot, the individual results of each characteristic shall be reported to give an indication of the variation in quality. In addition to this, the weighted average of the results for each characteristic shall be also calculated from the following formula:

Average 
$$(x) = \frac{(x_1 \times w_1 + x_2 \times w_2 + \dots x_n \times w_n)}{W}$$

where

 $x_1, x_2, \dots, x_n$  are the individual results of n gross samples for the particular characteristic,

 $w_1, w_2, \dots, w_n$  are the weights of individual sub-lots, and W is the total weight of the lot  $(= w_1 + w_2 + \dots w_n)$ .

(Continued from page 2) Members Representing DR U. N. BHRANY Indian Iron & Steel Co Ltd. Burnpur SHRI A. C. MURHERJEE ( Alternate ) SHRI G. C. DE Export Inspection Council of India, Calcutta SHBI P. K. CHATTERJEE (Alternate) SHRI G. V. HALWE Directorate General of Supplies & Disposals (Ministry of Works, Housing & Supply) SHBI S. N. DASGUPTA ( Alternate ) SHRI S. S. HONAVAR Italab Private Ltd, Bombay SHRI J. C. DEY (Alternate) (Calcutta) SHRI J. P. PATEL ( Alternate ) (Bombay) SHRI N. C. JAIN Minerals & Metals Trading Corporation of India Ltd, New Delhi DR N. JAYABAMAN Essen & Co, Bangalore SHRI M. R. G. SHARMA ( Alternate ) SHRI G. P. MATHUR National Metallurgical Laboratory (CSIR) Jamshedpur SHRI A. K. MITRA Mitra S. K. Private Ltd, Calcutta SHRI M. N. MITRA ( Alternate ) SHBI M. M. MOUDGILL Índian Aluminium Co Ltd. Calcutta SHBI G. RANGABAJAN National Mineral Development Corporation Ltd. New Delhi SHRI M. R. ROY Inspection & Testing Co (India) Private Ltd, Calcutta SHRI A. CHAUDHURY ( Alternate ) SHRI S. SUBBAMANIAM General Superintendence Co (India) Private Ltd.

Bombay
Shri Herman Pinto ( Alternate )

SHRI SURESH NABAIN Government of Goa, Daman and Diu, Panjim

## BUREAU OF INDIAN STANDARDS

Headquarters:	
Manak Bhavan, 9 Bahadur Shah Zafar Marg, NEW DELHI 1	10002
Telephones: 331 01 31, 331 13 75  Telegrams: Ma ( Common to	
Regional Offices:	Telephone
	(331 01 31 331 13 75
*Eastern : 1/14 C. I. T. Scheme VII M, V. I. P. Road, Maniktola, CALCUTTA 700054	36 24 99
Northern: SCO 445-446, Sector 35-C, CHANDIGARH 160036	{ 2 18 43 } 3 16 41
Southern: C. I. T. Campus, MADRAS 600113	41 24 42 41 25 19 41 29 16
†Western : Manakalaya, E9 MIDC, Marol, Andheri (East), BOMBAY 400093	
Branch Offices:	
'Pushpak', Nurmohamed Shaikh Marg, Khanpur, AHMADABAD 380001	<b>3 63 48 2 63 49</b>
†Peenya Industrial Area 1st Stage, Bangalore Tumkur Road BANGALORE 560058	
Gangotri Complex, 5th Floor, Bhadbhada Road, T. T. Nagar, BHOPAL 462003	6 67 16
Plot No. 82/83, Lewis Road, BHUBANESHWAR 751002 53/5. Ward No. 29, R.G. Barua Road, 5th Byelane, GUWAHATI 781003	5 36 27 3 31 77
5-8-56C L. N. Gupta Marg ( Nampally Station Road ), HYDERABAD 500001	23 10 83
R14 Yudhister Marg, C Scheme, JAIPUR 302005	<b>6 34 71 6 98 32</b>
117/418 B Sarvodaya Nagar, KANPUR 208005	21 68 76 21 82 92
Patliputra Industrial Estate, PATNA 800013	6 23 06
T.C. No. 14/1421. University P.O., Palayam TRIVANDRUM 695035	{6 21 04 6 21 17
Inspection Offices ( With Sale Point ):	
Pushpanjali, First Floor, 205-A West High Court Road, Shankar Nagar Square, NAGPUR 440010	2 51 71
Institution of Engineers (India) Building, 1332 Shivaji Nagar PUNE 411005	, 5 24·35
*Sales Office in Calcutte is at 5 Chowringhee Approach, P. O. Pring	27 68 00

<sup>\*</sup>Sales Office in Calcutte is at 5 Chowringhee Approach, P. O. Princep 27 68 00 Street, Calcutte 700072

<sup>†</sup>Sales Office in Bombay is at Novelty Chembers, Grant Road, 89 65 25 Bombay 400007

<sup>2</sup>Sales Office in Bangalore is at Unity Building, Narasimharaja Square, 22 36 71 Bangalore 560002